


Structural Sewing Inspection Sheet - Viper 2 & Vixen Harness

The image of the harness shows all structural sewing present and correct, highlighted by the green circles.

Structural sewing is always done in thread with a contrasting colour to the colour of the webbing.

Check your harness in the green circled areas on both sides of the webbing.

The red circle below shows an example of missing structural sewing.

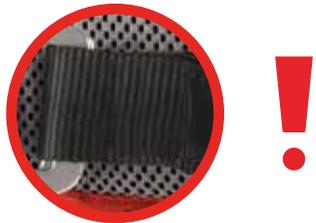

If structural sewing is missing stop use and contact DMM:

returns@dmmwales.com
+44 (0)1286 872 222

This sheet refers to Viper 2 and Vixen harnesses:

VIPE2-S VIX-XS
VIPE2-M VIX-S
VIPE2-L VIX-M
VIX-L



Structural sewing at positions 6 & 7 is visible under webbing